

Steering parameter adjustment for three wheel electric forklift

Prepared by:Joey Date:2022/8/5





- 1 To input password
- 2 Streering parameter monitor
- 3 To adjust streering parameter
- 4 Sotre parameter



Key switch on, press the "OK" key, enter the password, the password is pressed 5 times " ∇ " key, press OK to enter.



2 Streering parameter monitor



a Move the cursor to "2 Operate monitor", click "OK" to enter.



KeyOnHour	6	P.MotorVoltage	D.
T.EnableHour	0		
REnableHour	0		
SteerPotVal	1		
AccelPotVal	26		
LiftPotVal	1289		

2 Streering parameter monitor



b Turn right to the end , look at the LiftpotVal change from 1289 to 2066. To record the value 2066

in right turn.



(eyOnHour	6	P.MotorVoltage	0			-	and the second second	17
T.EnableHour	0		-		KeyOnHour	6	Participant and	
REnableHour	0				TEnableHour	0		
SteerPotVal	1				P.EnableHour	0		
AccelPotVal	26			1 1	SteerPotVal	1		
LiftPotVal	1289				AccelPotNal	28		
-					LittPotVal	2066		

2 Streering parameter monitor



c Turn left to the end , look at the LiftpotVal change from 2066 to 736. To record the value 736 in left turn.



		00000				OP
	-	PlintorVoltage	-	KeyOnHour	6	P.MotorVolta
KeyOnHour	0	-		T.EnableHour	0	
PEnableHour	0			 P.EnableHour	0	
SteerPotVal	1			SteerPotVal	1	
AccelPotVal LittPotVal	2066			AccelPotVal	26	
				LiftPotVal	736	

3 To adjust streering parameter



a Move the cursor to "8 Steer set", click "OK" to enter.





3 To adjust streering parameter



b Move the cursor to "SteerPotActiveHigh", click "OK" to enter. To adjust the number from 1856 to 2066. (Right turn value)



3 To adjust streering parameter



c Move the cursor to "SteerPotActiveLow", click "OK" to enter. To adjust the number from 720 to 736. (Left turn value)



4 Sotre parameter



a Move the cursor to "10 Other set", click "OK" to enter.







B Move the cursor to "StorePara", click "OK" to enter. To change the number from 0 to 1, click the confirm button. Then restart the machine, done.



